

AD-A064 011

CORPS OF ENGINEERS BALTIMORE MD BALTIMORE DISTRICT F/G 13/2
NATIONAL DAM INSPECTION PROGRAM. PARKER POND DAM (NDI MD00085),--ETC(U)
AUG 78

F/G 13/2

UNCLASSIFIED


NL

1 OF 1

AD
A064011

END
DATE
FILMED

3--79
DDC

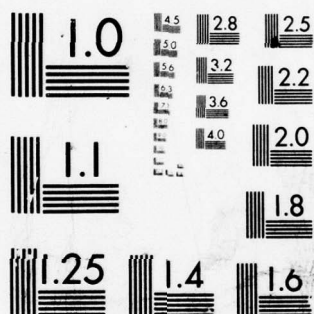

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

AD A064011

DDC FILE COPY

LEVEL II


1

WICOMICO RIVER BASIN
BEAVERDAM CREEK, WICOMICO COUNTY
MARYLAND

PARKER POND
NDI NO. MD 00085

PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION PROGRAM

DDC
RECEIVED
JAN 31 1979
D

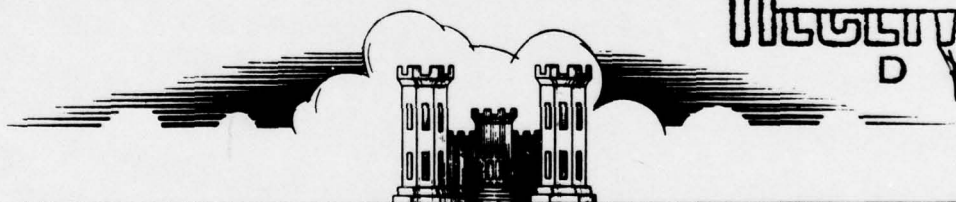

DISTRIBUTION STATEMENT A
Approved for public release;
Distribution Unlimited

409111

DEPARTMENT OF THE ARMY
Baltimore District, Corps of Engineers
Baltimore, Maryland 21203

Prepared By: Maryland Water Resources Administration
AUGUST 1978

79 01 17 096

120
418

DISCLAIMER NOTICE

**THIS DOCUMENT IS BEST QUALITY
PRACTICABLE. THE COPY FURNISHED
TO DDC CONTAINED A SIGNIFICANT
NUMBER OF PAGES WHICH DO NOT
REPRODUCE LEGIBLY.**

LEVEL II

①

WICOMICO RIVER BASIN
BEAVERDAM CREEK, WICOMICO COUNTY
MARYLAND

PARKER POND DAM
NDI NO. MD00085

PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION PROGRAM

⑥
National Dam Inspection Program.
Parker Pond Dam (NDI MD00085),
Wicomico River Basin, Beaver Dam Creek,
Wicomico County, Maryland.
Phase I Inspection Report.

⑫ 55 p.

DEPARTMENT OF THE ARMY
Baltimore District, Corps of Engineers
Baltimore, Maryland 21203

Prepared By: Maryland Water Resources Administration

DDC
RECEIVED
JAN 31 1979
D

| | |
|---------------------------------|--|
| SUBMISSION BY | |
| DTM | Office Section <input checked="" type="checkbox"/> |
| DD | Dist Section <input type="checkbox"/> |
| UNCLASSIFIED | <input type="checkbox"/> |
| JUSTIFICATION | |
| Per DDC Form 5 | |
| BY on file | |
| DISTRIBUTION/AVAILABILITY CODES | |
| Dist. | AVAIL. OR/WR SPECIAL |
| A | 23 |

⑪ August 1978

79 01 17 096

DISTRIBUTION STATEMENT A
Approved for public release;
Distribution Unlimited

409 111

✓B

TABLE OF CONTENTS

| | PAGE |
|---|------|
| SECTION 1 - PROJECT INFORMATION | 1 |
| 1.1 General | 1 |
| 1.2 Description of Project | 1 |
| 1.3 Pertinent Data | 2 |
| SECTION 2 - ENGINEERING DATA | 4 |
| 2.1 Design | 4 |
| 2.2 Construction | 4 |
| 2.3 Operation | 4 |
| SECTION 3 - VISUAL INSPECTION | 5 |
| 3.1 Findings | 5 |
| SECTION 4 - OPERATIONAL PROCEDURES | 7 |
| 4.1 Procedures | 7 |
| 4.2 Maintenance of Dam & Operating Facilities | 7 |
| 4.3 Warning System | 7 |
| 4.4 Evaluation | 7 |
| SECTION 5 - HYDRAULIC/HYDROLOGIC | 8 |
| 5.1 Evaluation of Features | 8 |
| SECTION 6 - STRUCTURAL STABILITY | 10 |
| 6.1 Evaluation of Structural Stability | 10 |
| SECTION 7 - ASSESSMENT, REMEDIAL MEASURES AND RECOMMENDATIONS | 11 |
| 7.1 Dam Assessment | 11 |
| 7.2 Remedial Measures and Recommendations | 11 |
| APPENDIX A - PHOTOGRAPHS | |
| APPENDIX B - VICINITY MAP, PLAN AND SECTION VIEW | |
| APPENDIX C - CHECK LISTS | |
| APPENDIX D - ANALYSIS | |
| APPENDIX E - GEOLOGY REPORT | |

PHASE I REPORT
NATIONAL DAM INSPECTION PROGRAM


Name of Dam: Parker Pond Dam
State Located: Maryland
County Located: Wicomico
Stream: Beaver Dam Creek
Date of Inspection: 14 July 1978
Inspection By: State of Maryland
Department of Natural Resources
Water Resources Administration


The Phase I review of Parker Pond Dam revealed the structure to be in good condition and relatively stable under normal operation. The dam structure is low, averaging less than 8 feet in height, and slope stability problems were not detected and are not anticipated. No seepage areas were observed during the field inspection.

Due to the unavailability of original hydrologic and hydraulic design computations, a preliminary analysis was performed based on data generated for the design of a downstream structure known as Beaglin Park Drive Dam located 1.5 miles below Parker Pond, the Salisbury By-Pass crossing of Parker Pond, and local gage records. The results of the analysis considering criteria for a dam in the low hazard category indicated the spillway system to be inadequate. Due to the overtopping potential and possible deleterious effects upon Beaglin Park Drive Dam, additional analysis was performed and revealed that Beaglin Park Drive impoundment is capable of receiving surcharge inflow in the event of failure of Parker Pond Dam.

Based upon visual observation, the existing level of maintenance is satisfactory, but operation and maintenance procedures should be documented in writing.

APPROVED BY:

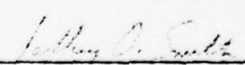
Jeffrey O. Smith
Chief, Dam Safety Division
Maryland Water Resources
Administration

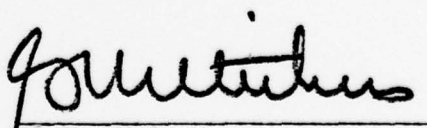
G. K. Withers
Colonel, Corps of Engineers
District Engineer

DATE: 23 Sep 78



Parker Pond Dam
MD 00085

PHASE I INSPECTION REPORT

NATIONAL DAM INSPECTION PROGRAM

PARKER POND DAM MD00085

SECTION 1 - PROJECT INFORMATION

1.1 General

a. Authority. The inspection was authorized by the Dam Inspection Act, Public Law 92-367, and was performed in accordance with the Maryland F. Y. 78 priority list.

b. Purpose of Inspection. The Phase I Inspection is an evaluation of existing engineering data and a visual inspection of the dam and appurtenances in an effort to determine if it constitutes a hazard to human life or property.

1.2 Description of Project

a. Description of Dam. Parker Pond is an earth embankment structure approximately 350 feet in length with two controlled spillways. The primary spillway is located at the original stream channel near the center of the dam and the other is located on the right (west) side of the dam. The right spillway is a reinforced concrete box structure designed to accept hydroelectric turbines to supply electricity to an adjacent dwelling. The principle spillway at the center of the dam is reinforced concrete with timber beam support for the roadway bridge over the spillway.

b. Location. The dam is located on Beaverdam Creek approximately 1.5 miles upstream from Beaglin Park Dam (Schumaker Pond) within the Wicomico River Drainage Basin.

c. Size Classification. Small: 13 feet high, 245 acre feet.

d. Hazard Classification. The potential for minimal property loss and no anticipated loss of life in the event of a dam failure places the dam in a low hazard category. The downstream channel is described in Section 3.1, e. and f.

e. Ownership. The structure is owned and operated by Wise H. Hinman. The road surface of Schumaker Road is owned and maintained by Wicomico County.

f. Purpose of Dam. The primary purposes of the dam are limited recreation and hydroelectric generation of electricity for the owner.

g. Design and Construction History. Parker Pond was constructed approximately 200 years ago with soil excavated in an area adjacent to the east side of the dam. The original purpose of the dam was to provide water power and grist and sawmill activities. In the late 1700's the pond was known as Robbin's Mill Lot owned by James B. Robbins. Prior to this the pond may have been referred to as Munguns' Mill Lot.

Through the years, title to the dam and milling operations changed hands several times and under the ownership of Mr. Schelshorn, milling activities ceased in 1906. The present owner, Mr. Wise H. Hinman, acquired the dam and mill in 1943. The gristmill at the principal spillway was demolished in 1956 when an automobile left the road and collided with it. The spillway remained intact, but the left downstream wingwall was damaged and is now shored with a timber beam. The former sawmill spillway at the right abutment of the dam was destroyed in 1956, apparently due to localized internal erosion. Mr. Hinman replaced the spillway with a reinforced concrete box structure and a hydroelectric turbine system for producing his own electricity.

h. Normal Operation Procedures. The water level in the impoundment is controlled by a series of manually operated wood and steel sluice gates at the primary and right spillways. Normal operation attempts to provide a specific pool level by raising or lowering the gates at the primary spillway with discharge flowing through open gates or over closed gates. During production of hydroelectric energy the gates on the right spillway are opened. The flow is generally regulated to a steady release rate.

1.3 Pertinent Data.

a. Drainage Area. $9.29 \text{ mi}^2 = 5947 \text{ acres}$

b. Discharge at Damsite. Unknown flow rate; highest water surface at gage height 2.30; normal pool gage height 1.10.

c. Elevation (feet above mean sea level).

Top of dam - 28.30
Spillway crest - 25.87 (Gates closed)
Sediment pool - 21.47 (Gates open)
Normal tailwater - 17.73
Streambed at centerline of dam - 15.5

d. Reservoir.

Length of maximum pool - 1.02 miles
Length of Recreation pool - .98 miles
Length of flood control pool - 1.00 miles

e. Storage (acre-feet).

Sediment pool - 30 acre-feet at elevation 21.47
Recreation pool - 130 acre-feet at elevation 25.87
Top of dam - 245 acre-feet at elevation 28.30

f. Reservoir Surface (Acres).

Top of dam - 55 acres
Recreational pool - 41.5 acres
Sediment pool - 15 acres

g. Dam.

Type - earth (and some stone)
Length - 350 feet
Height - 12.8 feet from top of dam to streambed

h. Spillway.

Type: The primary spillway is a steel reinforced concrete overflow structure controlled by three steel gates on the upstream face. A timber beam bridge approximately 17 feet in length spans the spillway.

The right spillway is a steel reinforced concrete box structure controlled by 3 wood gates on the upstream side and one large steel gate on the downstream side. Within this flume are two turbines for hydroelectric generation.

Length of Weir:

Right spillway - 7.5 feet total, upstream face
Primary spillway - 7.5 feet total, upstream face

Crest Elevation:

Right spillway - 26.39 (Gate Closed)
 22.94 (Gate Open)
Primary spillway - 25.87 (Gate Closed)
 21.47 (Gate Open)

Gates: The primary spillway has three gates, two of which are controlled manually and the other opened by a screw apparatus which can be driven by a portable electric motor.

The right spillway has 3 gates on its upstream and 1 gate on its downstream side, all controlled by hand. A chain fall is attached to the downstream gate. Emergency drawdown may be effected by operation of the sluice gates.

SECTION 2 - ENGINEERING DATA

2.1 Design: Availability of Information. Parker Pond Dam was erected approximately 200 years ago and original design information is unavailable. Stone and earth was apparently excavated from the area adjacent to the east side of the embankment. The hydroelectric spillway, rebuilt after loss of the original spillway, at the right abutment, was constructed without the benefit of engineering analysis or plans. Mr. Hinman, builder of the replacement spillway and dam owner claims to have laid riprap in the dam core in the area of the spillway.

2.2 Construction: Availability of Information. No drawings or construction records are available.

2.3 Operation: Availability of Information. No detailed operational data is available. Stage information was recorded for a period of time for Wicomico County but the data is no longer current. Operation of the spillway gates is subject to the discretion of the owner. Use of the right spillway is more frequent during the winter months due to greater hydroelectric need. Operation procedures and records are not documented and are unavailable for review.

SECTION 3 - VISUAL INSPECTION

3.1 Findings

a. General. The field inspection was accomplished 14 July 1978. Prior to this several interviews were conducted with the owner, Mr. Wise H. Hinman, to establish an accurate history of Parker Pond.

b. Dam.

- (1) There appears no cracking, sloughing or other indication of appreciable movement in the embankment.
- (2) Minor erosion exists on the downstream slope at the right bridge abutment.
- (3) Woody vegetation including a few large trees were observed on the downstream slope of the dam.
- (4) The vertical and horizontal alignment are good with no evidence of settlement.
- (5) All junctions of the embankment and abutment, spillways and dam appear to be stable. A staff gage with .02 ft. intervals is located on the right wingwall of the intake channel to the principal spillway. A Water Resources Administration topographic survey bench mark is located on the top right side of the upstream headwall of this same spillway and was used to establish a traverse survey around the pool as well as a roadway profile.
- (6) No areas of seepage were detected.

c. Appurtenant Structures.

- (1) The right spillway is constructed of steel reinforced concrete, (see photo of photograph during reconstruction). The approach channel consists of 60° wooden wingwalls and 3 wooden, hand operated gates on the upstream face separated by 2 square nose piers. The downstream gate of this spillway is 5.5 feet high by 4 feet wide steel plate operated by a chain fall. This spillway terminates in housing for twin horizontal turbines for hydroelectric generation, discharging into a wide pool. The road surface was paved shortly after the washout in the fall of 1956.
- (2) The primary spillway approach channel consists of 45° timber wingwalls. This spillway has 3 steel gates on its upstream face, 2 of which are operated by hand and 1 which is driven by automobile differential. In addition, the gates can be

topped with 8" x 3/4" x 2.5' plywood extensions. The spillway is concrete and may not be reinforced with steel. Some honeycombing of the abutments is present. Visible bracing consists of large creosoted timber beams, some of which form the deck of the road. The road surface is owned and maintained by Wicomico County, excluding the timber decking. Discharge from the primary spillway is into a wide pool separate from the discharge pool of the right spillway. The left downstream concrete wingwall, approximately 8 feet in height, contains a horizontal crack along its midsection. The top of the wall has deflected toward the discharge channel approximately 1 to 2 inches and is braced by heavy timber.

d. Reservoir Area. New home construction on the east side of Parker Pond is slightly defoliating the heavily wooded area between the pond and the new Salisbury by-pass. The slope on this side of the pond is relatively steep compared to the flatter slopes of the west side. The west side is also wooded with corn fields beyond. These slopes are also stable.

The upper end of the reservoir, just below the twin bridges of the Salisbury by-pass is shallow with thick stands of aquatic vegetation.

e. Downstream Channel. Two downstream channels exist, one each at the primary spillway and right spillway. These channels are deep and stable, wind through thick woods, and converge about 500 feet downstream (reference APPENDIX B, Vicinity Map).

f. Danger Reach. In the event of dam failure only a heavily wooded area between Parker Pond and Schumaker Pond would be inundated.

SECTION 4 - OPERATIONAL PROCEDURES

4.1 Procedure As explained in Section 1.2 (h) and 2.3, the operation of the dam is mainly at the discretion of the owner. Sufficient pool level for hydroelectric generation and limited recreation dictates the dam's operation. The owners presently attempt to maintain a constant pool level at the spillway crest elevation with the gates closed. During periods of heavy rainfall, the owner opens the gates to prevent high pool levels.

4.2 Maintenance of Dam and Operating Facilities No established written procedures for maintenance of the dam and its operating facilities exist. The present owner has accomplished remedial construction by replacing the right spillway and performing general repairs to the principal spillway. Mr. Hinman appears to produce adequate maintenance for the dam and spillways on an as-needed basis.

4.3 Warning System No formal warning system exists for Parker Pond Dam.

4.4 Evaluation The owner's attention toward controlling pool levels during rainfall and personal financial investment, even though the dam serves as a public right of way, exhibit a responsible attitude toward the operation and maintenance of Parker Pond Dam.

SECTION 5 - HYDRAULIC/HYDROLOGIC

5.1 Evaluation of Features

a. Design Data. There is no known design data for Parker Pond. Pertinent design data was developed (1975) for the replacement structure for Schumaker Dam (Beaglin Park Drive Dam - MD 00204) located approximately 1.5 miles downstream, and for the Salisbury By-pass crossing (1976) of Parker Pond. These data and local gauge records were utilized to establish an estimate for the Spillway Design Flood (SDF) for Parker Pond. The Vicinity Map in APPENDIX B can be used to locate the Beaverdam Creek watershed and the above mentioned structures. The design data and gauge records are summarized in APPENDIX D, Analysis.

b. Experience Data. The highest water surface recalled by the present owner was at staff gauge height 2.30 equivalent to elevation 27.07. The discharge rate corresponding to this elevation is unknown since the specific operation of the six gates could not be recalled. The date also could not be recalled. The gauge was apparently installed by the USGS for a special study of the basin yield for the period April, 1950 through March, 1952. Gauge heights at Parker and Schumaker Ponds are published for that time period in USGS Water Supply Paper 1472. In 1956, the former sawmill spillway at the right abutment (presently the headrace for the hydro-electric generating facility) was destroyed. The alleged cause was internal erosion and not overtopping. No regular record keeping by the owner relative to gauge heights or gate operations exists. No reference to Parker Pond ever being overtopped was gleaned from the project's historical records.

c. Visual Observations. On the date of the inspection, no conditions were observed which would indicate that the spillways of Parker Pond could not operate satisfactorily in the event of a flood. It should be noted that the owner operates the spillways based upon his need for electric energy and in the interest of preventing the dam from overtopping.

d. Overtopping Potential and Evaluation. The dam has a maximum height of approximately 13 feet with the corresponding storage of approximately 245 acre-feet. The dimensions indicate a size classification of "small," and the hazard classification is "low" based upon the observed downstream conditions. The recommended Spillway Design Flood (SDF) for a dam with the above classification is the 50 to 100-year frequency flood event. The magnitude of the SDF selected is based on the economic consequences of failure - the dam replacement cost, and the temporary loss of a County roadway. Additionally, the minimum flood to be considered for a dam in the low hazard category is the 100-year flood event as mandated by State Regulations.

Accordingly, the SDF for this dam is judged to be the 100-year flood event.

Based upon gauge records and other design data (APPENDIX D) for related structures, the 100-year frequency flood event for Parker Pond is calculated to be 660 cfs (71 CSM) with a resulting inflow volume of 2166 (4.37 watershed inches) acre-feet. The maximum spillway capacity of 363 cfs represents 55 percent of the SDF. The approximate routing indicates that 975 acre-feet of incremental storage would be necessary to pass the SDF without overtopping. The spillway is considered inadequate because only 215 acre-feet of incremental flood storage is available. The 25-year frequency flood event is calculated to be 469 cfs with a resulting inflow volume of 1506 acre-feet (3.04 watershed inches). The maximum spillway capacity of 363 cfs represents 78 percent of the 25-year frequency flood event. Approximate routings indicate that the dam also can not pass the 25-year frequency flood event without overtopping.

Because no loss of life or serious economic consequences are envisioned due to the failure of Parker Pond, the spillway is not considered seriously inadequate. However, the possibility of a "domino effect" on the downstream dam and resulting consequences beyond the scope of this review prompted an analysis to determine the effect of Schumaker Pond in the event of Parker Pond Dam failure. The results indicate that Beaglin Park Drive Dam will not overtop even if it is at its design high water (4000 cfs, 200 CSM) and an unrouted (channel) failure hydrograph from Parker Pond is routed (reservoir) through it by approximate methods.

e. Spillway Adequacy. Based upon the recommended guidelines, the spillway cannot pass the 100-year frequency flood event without overtopping. Therefore, the spillway is considered inadequate. However, an unplanned overflow area (See Plan View, APPENDIX B) near the left abutment probably would pass safely the SDF. No damages are expected should this dead-end roadway convey overflows from Parker Pond. No specific studies to answer this question were accomplished. Additionally, changed hydraulic conditions as evidenced by construction of the dual bridges (Salisbury By-pass) over the upper end of Parker Pond should result in a reduced SDF peak because of the temporary storage provided by the highway. Consequently, additional hydraulic studies, if performed, may result in a revised statement of spillway adequacy or a scheme for reducing the overtopping potential. Should the owners and/or County decide to not perform such an analysis, they must be aware of the spillway inadequacy as assessed at this time. The Water Resources Administration is currently performing flood insurance studies in the Beaverdam Creek Watershed for the U. S. Department of Housing and Urban Development. Data generated for this program should be sufficient to assess the overtopping potential at Parker Pond in detail.

SECTION 6 - STRUCTURAL STABILITY

6.1 Evaluation of Structural Stability

a. Visual Observations. No visible signs of appreciable movement or distress were detected in the earthen embankment or the concrete spillways. The majority of the dam is relatively low (less than 10 feet in height) and slope stability problems under normal or high flow conditions are not anticipated. Although the embankment in the vicinity of the right spillway eroded and failed in 1956, no evidence of seepage or internal erosion was observed during the inspection. Based upon visual observation the embankment is considered to be structurally and hydraulically stable. As mentioned in Section 3.1.b. woody vegetation covers portions of the downstream face of the dam. Although the trees are old and root systems could be extensive and deep, no evidence of seepage or piping problems attributable to vegetation were observed.

According to the owner, the cracked and deflected downstream wingwall of the left side of the principal spillway resulted from the impact of a vehicle which crashed into the mill house partially supported by the wingwall. The upper portion of the wall was braced with heavy timber to prevent further movement, and the wall appears stable. The bridge over the spillway appears adequate and the owner maintains a 5 ton limit.

b. Design and Construction Data. Design and computations analyzing the structural and hydraulic stability of the dam configuration are unavailable, and quite likely, may never have been performed.

c. Operating Procedures. Detailed operating procedures were unavailable for review and factors which might affect stability could therefore not be assessed.

d. Post Construction Changes. Since the original construction of this dam took place more than 200 years ago, modifications and changes were probably performed. Visual observation indicates that the primary spillway was probably rebuilt prior to 1930 and the owners indicate that the spillway at the right side of the dam was rebuilt in 1956. These modifications should not affect the stability of the dam.

e. Seismic Stability. The Parker Pond Dam is located in Seismic Zone 1 and static stability of the dam is considered adequate based on visual observation. Based upon the recommended guidelines, the dam presents no hazard from earthquake activity.

SECTION 7 - ASSESSMENT, REMEDIAL MEASURES AND RECOMMENDATIONS

7.1 Dam Assessment Assessment of Parker Pond Dam was based upon field review and hydrologic and hydraulic data generated for the design of a downstream structure known as Beaglin Park Drive Dam, the design of the Salisbury By-pass crossing over Parker Pond, and local gauge data. Based upon visual inspection, the earthen embankment, concrete spillways, and bridge over the primary spillway appear in good condition and stable under normal operation. Preliminary analyses indicate the spillway system to be inadequate for the 100-year storm event, but the downstream Schumaker Pond should be capable of receiving surcharge inflow in the event of Parker Pond Dam failure. As no loss of life or measureable property damage is anticipated in the event of dam failure, the inadequacy of the spillway is judged not to require immediate remedial measures.

7.2 Remedial Measures and Recommendations The findings of this Phase I investigation indicate the following:

a. Structure and Appurtenances. The dam structure and appurtenances are considered to be stable under normal operating conditions. Due to the past failure of the spillway at the right abutment, apparently through internal erosion, the dam should be inspected routinely to detect development of seepage zones and/or loss of embankment material.

b. Operation and Maintenance Procedures. It is recommended that operation and maintenance procedures be documented in writing.

APPENDIX A - PHOTOGRAPHS



Top of dam
east view



Downstream slope
east view

Parker Pond MD 00085




(Photo reproduction) construction of
west (hydroelectric) spillway 1956



Downstream view of west (hydroelectric)
spillway



Downstream between spillway channels
Parker Pond MD00085

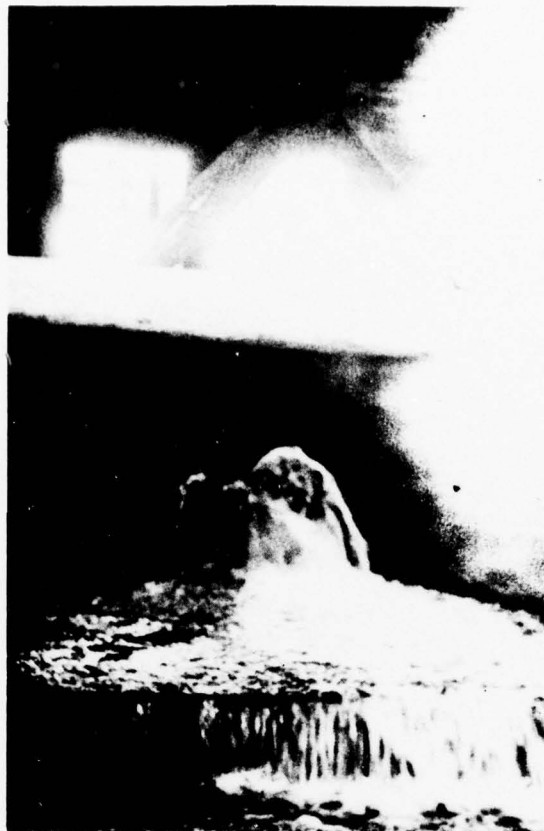

East spillway




East spillway
upstream face

Parker Pond
MD 00085

APPENDIX B

VICINITY MAP, PLAN & SECTION VIEW

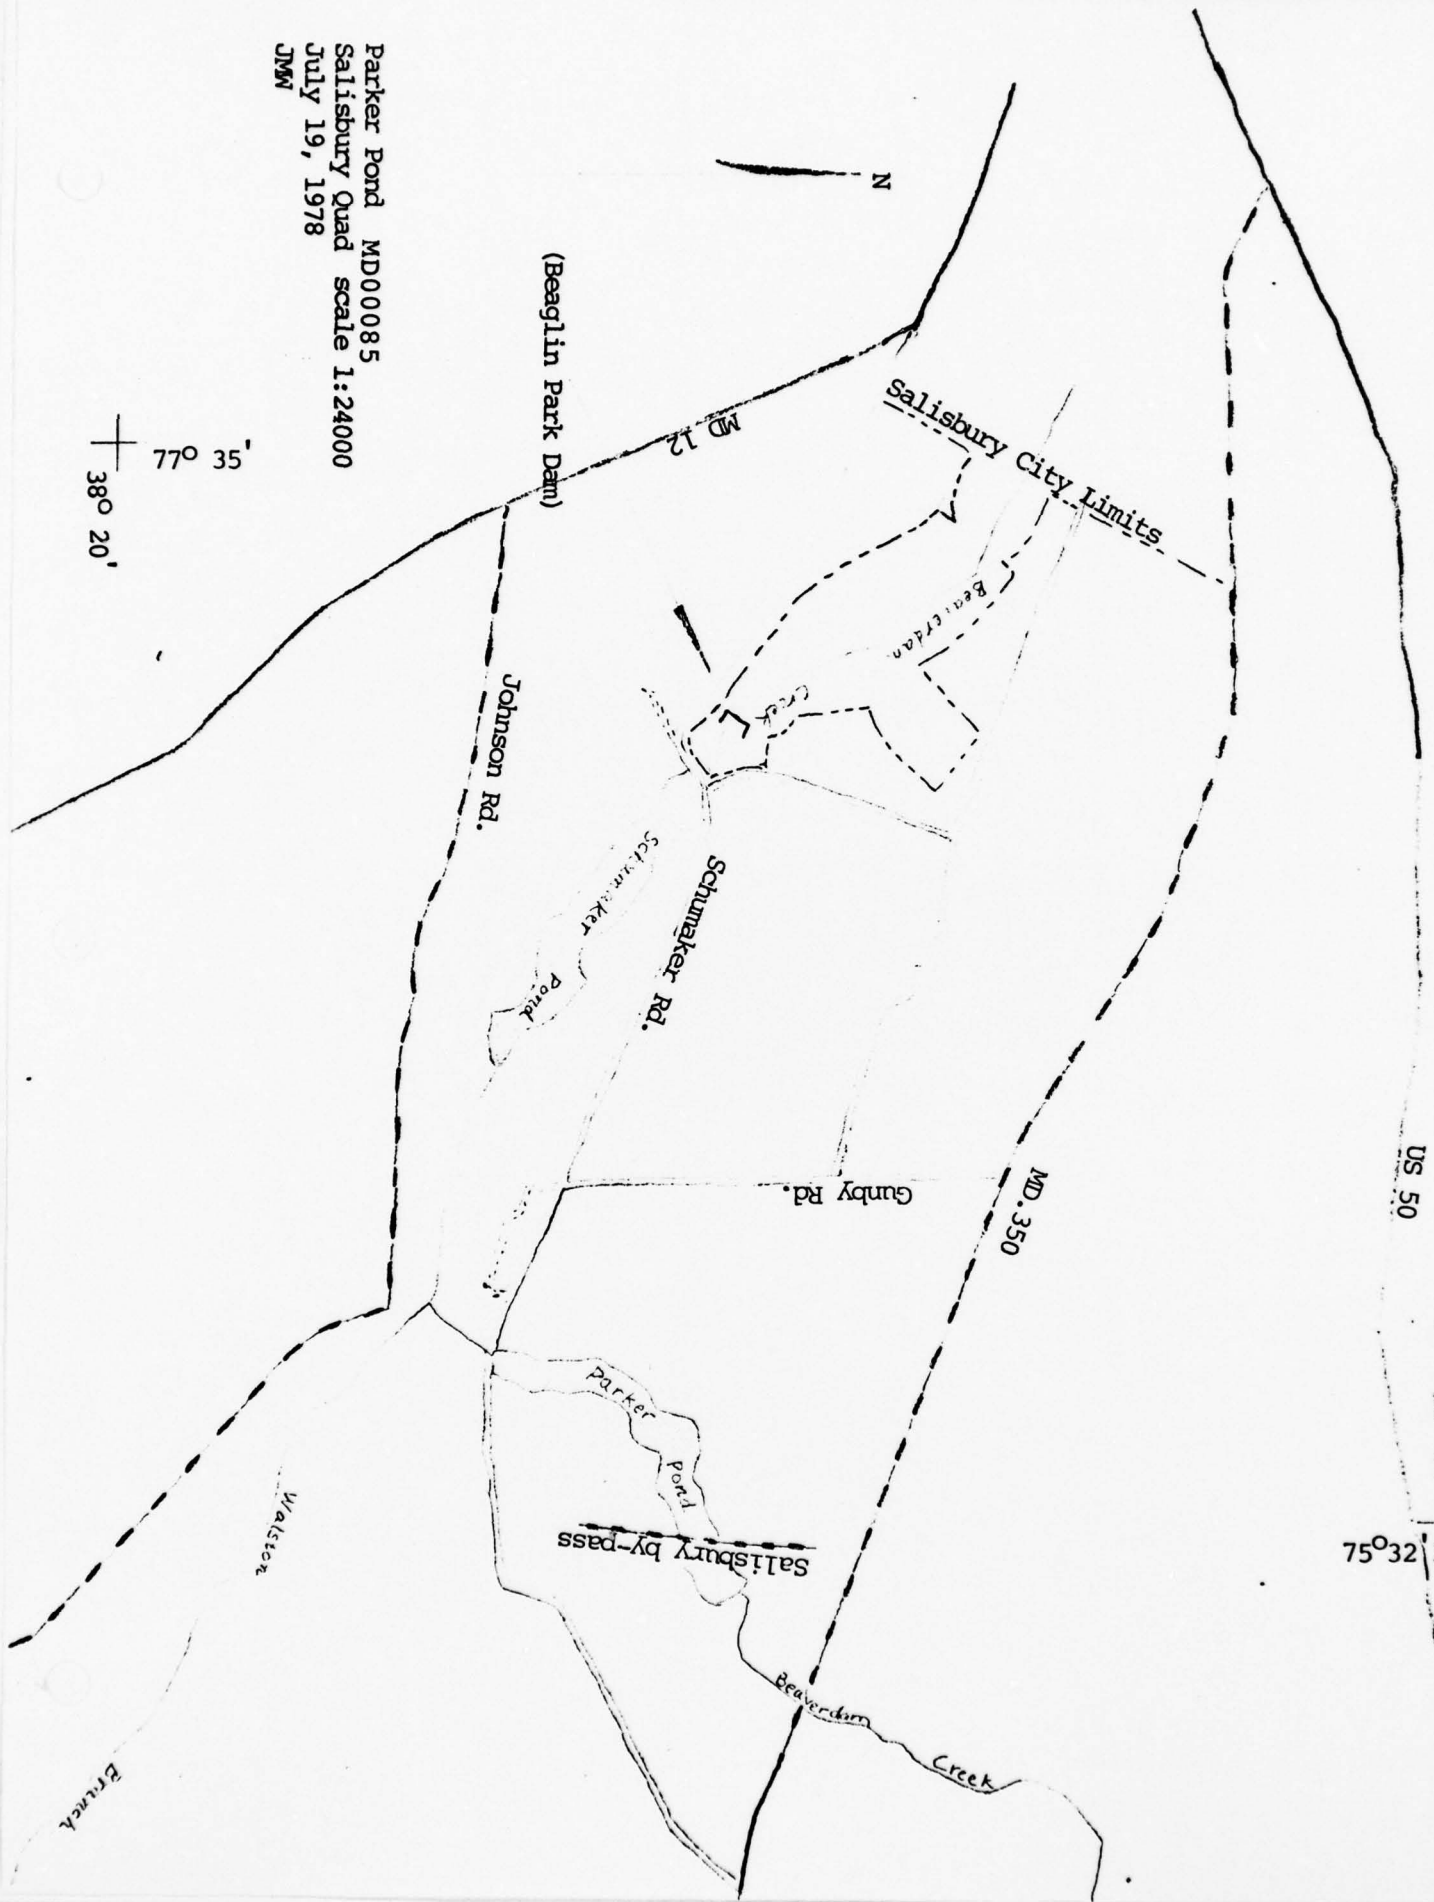


Parker Pond MD00085
Salisbury Quad scale 1:24000
July 19, 1978
JMW

77° 35'
38° 20'

US 50
38° 22' 30" +
75° 32' 30"

N

unplanned overflow
area along paved
road

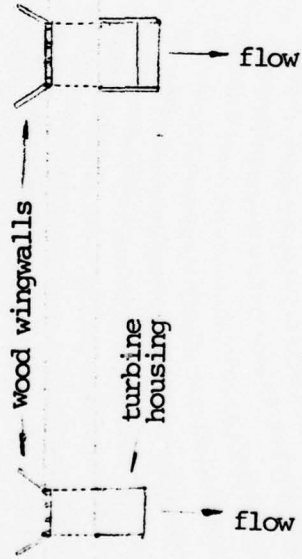

stream channels converge
1/8 mile downstream

300


200

100

50

0

Top view Parker Pond 00085
scale 1"=50'

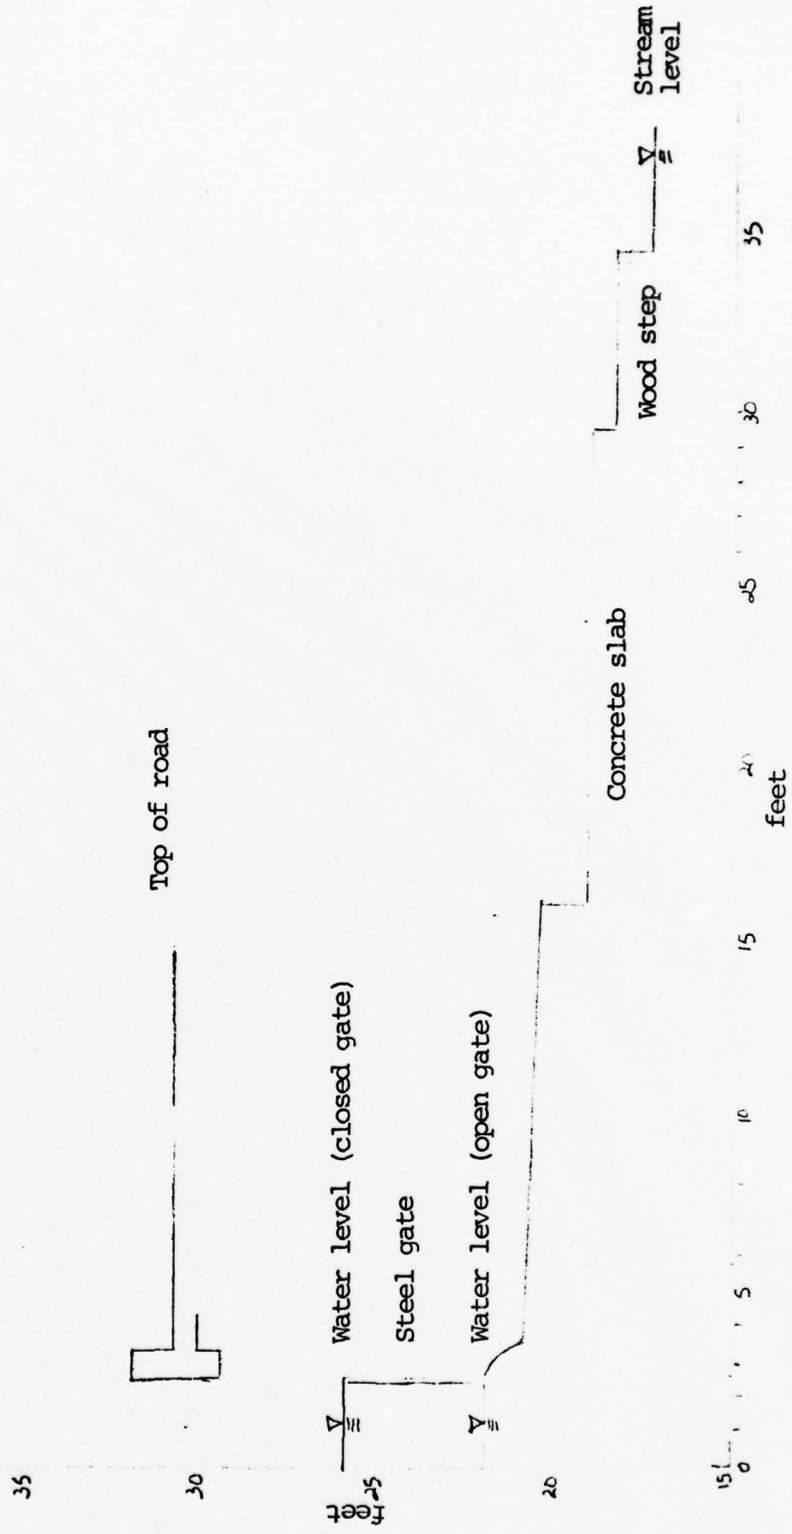

East spillway cross section
Parker Pond
MD 00085

APPENDIX C - CHECK LISTS

Check List
Visual Inspection
Phase 1

Name Dam Parker Pond Dam County Wicomico State Maryland ID # MD 00085
Type of Dam earth Hazard Category I
Date(s) Inspection 14 July '78 Weather cloudy Temperature 70°F

Pool Elevation at Time of Inspection 25.9 M.S.L. Tailwater at Time of Inspection 17.8 M.S.L.

Inspection Personnel:

J. Smith _____ J. Wagner _____
T. Moynahan _____
D. Moore _____

J. Smith _____ Recorder _____

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

7-13

S: 5 1-9 2

EMBANKMENT

REMARKS OR RECOMMENDATIONS

OBSERVATIONS

VISUAL EXAMINATION OF

SURFACE CRACKS

NONE

UNUSUAL MOVEMENT OR
CRACKING AT OR BEYOND
THE TOE

NONE

SLOUGHING OR EROSION OF
EMBANKMENT AND ABUTMENT
SLOPES

Minor erosion, downstream slope at right bridge abutment

VERTICAL AND HORIZONTAL
ALIGNMENT OF THE CREST

22' top width, good alignment, no evidence of settlement

RIPRAP FAILURES

N/A

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

EMBANKMENT

| VISUAL EXAMINATION OF | OBSERVATIONS | REMARKS OR RECOMMENDATIONS |
|-----------------------|--------------|----------------------------|
|-----------------------|--------------|----------------------------|

| | | |
|---|--------|--|
| JUNCTION OF EMBANKMENT AND ABUTMENT, SPILLWAY AND DAM | Stable | |
|---|--------|--|

| | | |
|------------------------|------|--|
| ANY NOTICEABLE SEEPAGE | NONE | |
|------------------------|------|--|

| | | |
|-------------------------|--|--|
| STAFF GAGE AND RECORDER | Staff at the right wall of the intake channel (wingwall), east spillway | |
|-------------------------|--|--|

| | | |
|--------|------|--|
| DRAINS | NONE | |
|--------|------|--|

Sheet 1 of 2

CONCRETE/MASONRY DAMS

VISUAL EXAMINATION OF

OBSERVATIONS

REMARKS OR RECOMMENDATIONS

ANY NOTICEABLE SEEPAGE

STRUCTURE TO
ABUTMENT/EMBANKMENT.
JUNCTIONS

DRAINS

WATER PASSAGES

FOUNDATION

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

CONCRETE/MASONRY DAMS

REMARKS OR RECOMMENDATIONS

OBSERVATIONS

VISUAL EXAMINATION OF

SURFACE CRACKS

CONCRETE SURFACES

STRUCTURAL CRACKING

VERTICAL AND HORIZONTAL
ALIGNMENT

MONOLITH JOINTS

CONSTRUCTION JOINTS

STAFF GAGE OF RECORDER:

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

OUTLET WORKS

VISUAL EXAMINATION OF

CRACKING AND SPALLING OF
CONCRETE SURFACES IN
OUTLET CONDUIT

INTAKE STRUCTURE

OUTLET STRUCTURE

OUTLET CHANNEL

EMERGENCY GATE

OBSERVATIONS

REMARKS OR RECOMMENDATIONS

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC

ENGATED SPILLWAY WEST SIDE

| VISUAL EXAMINATION OF | OBSERVATIONS | REMARKS OR RECOMMENDATIONS |
|--------------------------------|---|--|
| CONCRETE WALL SILL | not observable | |
| APPROACH CHANNEL | 60' timber wingwall | |
| DISCHARGE CHANNEL | wide pool | |
| BRIDGE AND PIERS | reinforced concrete deck took photo of photograph during reconstruction | paved after washout during fall '56. |
| GATES & OPERATION EQUIPMENT | # 3 gates hand controlled | 3 wooden gates upstream 5.5' wide x 4' high metal gate chainfall downstream twin horizontal |

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC

GATED SPILLWAY EAST SIDE

| SUAL EXAMINATION OF | OBSERVATIONS | REMARKS OR RECOMMENDATIONS |
|-------------------------------|---|--|
| NCRETE SILL | O.K. no known cracks unobservable today pictures taken 2wks. prior 24 June '78 | |
| APPROACH CHANNEL | 45° timber wingwall | |
| DISCHARGE CHANNEL | wide pool; no underscour. | |
| BRIDGE AND PIERS | creosoted timber beams (deck) county maintained road surface abutments-honeycombing, no exposed steel may not be any steel reinforcing beams are butted to form road subsurface | upstream headwall east side cracked & removeable above road surface only 17.6' from out to out headwalls |
| GATES AND OPERATION EQUIPMENT | 3 gates separated by two square piers two gates (left & right) wood operated by hand | steel gate (center) operated by car differential all gates topped with 8"x3/4" plywood extension |

THIS PAGE IS BEST QUALITY PRACTICABLE FROM COPY FURNISHED TO HQ

INSTRUMENTATION

REMARKS OR RECOMMENDATIONS

VISUAL EXAMINATION

OBSERVATIONS

MONUMENTATION/SURVEYS

W.R.A. topographic survey BM on east spillway upstream headwall used for traverse around pool & roadway cross section

OBSERVATION WELLS

NONE

WEIRS

NONE

PIEZOMETERS

NONE

OTHER STAFF GAGE

2/100 inch intervals

attached to right wingwall of approach channel

THIS PAGE IS BEST QUALITY PRACTICABLE FROM COPY FURNISHED TO DDG

RESERVOIR

REMARKS OR RECOMMENDATIONS

OBSERVATIONS

VISUAL EXAMINATION OF

SLOPES

East side steep and heavily wooded - new home construction, called Colony East
West side flatter, wooded with corn fields beyond

SEDIMENTATION

Upper end, just below the Salisbury By-pass twin bridges is shallow and wide
with lots of aquatic vegetation.

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

DOWNSTREAM CHANNEL

REMARKS OR RECOMMENDATIONS

VISUAL EXAMINATION OF

OBSERVATIONS

CONDITION
(OBSTRUCTIONS,
DEBRIS, ETC.)

Wide wooded floodplain
2 stable wooded stream channels converge 500' downstream

SLOPES

APPROXIMATE NO.
OF HOMES AND
POPULATION

NONE

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

CHECK LIST
HYDROLOGIC AND HYDRAULIC
ENGINEERING DATA

PARKER POND
MD 00085

DRAINAGE AREA CHARACTERISTICS: _____

ELEVATION TOP NORMAL POOL (STORAGE CAPACITY): 25.9 (130 acre feet) _____

ELEVATION TOP FLOOD CONTROL POOL (STORAGE CAPACITY): _____

ELEVATION MAXIMUM DESIGN POOL: _____

ELEVATION TOP DAM: 28.3 _____

CREST:

- a. Elevation 28.3 _____
- b. Type earth dam with paved road surface _____
- c. Width 22 ft. max. _____
- d. Length 350 ft. _____
- e. Location Spillover _____
- f. Number and Type of Gates 6 gates 3 steel 3 wood _____

OUTLET WORKS:

- a. Type controlled _____
- b. Location center of old streambed & left end of dam _____
- c. Entrance inverts 26.39 _____
- d. Exit inverts 16.1 _____
- e. Emergency draindown facilities open all 6 gates _____

HYDROMETEOROLOGICAL GAGES:

- a. Type staff gage _____
- b. Location upstream wingwall of principal spillway _____
- c. Records USGS report & owner _____

MAXIMUM NON-DAMAGING DISCHARGE: _____

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC

REMARKS

No written plans exist.
Dam Safety Division has created cross section and profile for main spillway

SPILLWAY PLAN

SECTIONS

DETAILS

OPERATING EQUIPMENT
PLANS & DETAILS

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC

REMARKS

TEM

MONITORING SYSTEMS

MODIFICATIONS

HIGH POOL RECORDS

1950 - 1952 USGS study - Water Supply Paper 1472

POST CONSTRUCTION ENGINEERING
STUDIES AND REPORTS

PRIOR ACCIDENTS OR FAILURE OF DAM
DESCRIPTION
REPORTS

In 1956 an automobile left the road way and totally destroyed the old mill house and part of the spillway wingwall (downstream side). The mill was removed. Also in 1956 the right side of the dam washed out due to internal erosion. The spillway was replaced with a concrete flume containing hydroelectric equipment. (two twin turbines)

MAINTENANCE
OPERATION
RECORDS

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC

REMARKS

TEM

DESIGN REPORTS

GEOLOGY REPORTS

DESIGN COMPUTATIONS
HYDROLOGY & HYDRAULICS
DAM STABILITY
SEEPAGE STUDIES

MATERIALS INVESTIGATIONS
BORING RECORDS
LABORATORY
FIELD

POST-CONSTRUCTION SURVEYS OF DAM

BORROW SOURCES

WRA HUD Flood Insurance Study

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

CHECK LIST
ENGINEERING DATA
DESIGN, CONSTRUCTION, OPERATION
PHASE I

NAME OF DAM

ID #

REMARKS

ITEM

AS-BUILT DRAWINGS

REGIONAL VICINITY MAP

CONSTRUCTION HISTORY

TYPICAL SECTIONS OF DAM

OUTLETS - PLAN

- DETAILS

- CONSTRAINTS
- DISCHARGE RATINGS

RAINFALL/RESERVOIR RECORDS

APPENDIX D - ANALYSIS

| Elev, FT above MSL | Area, in ² | Area, Acres | Area, Avg. | Δ Vol, Ac-FT | Cum. Vol, Ac-FT |
|-----------------------|-----------------------|-------------|------------|--------------|-----------------|
| 18 invert | | 0 | | | |
| 26 | 732 | 42.01 | — | 135' | 135 |
| 28 | 949 | 54.41 | 48.21 | 96 | 231 |
| 30 | 1044 | 59.92 | 57.16 | 114 | 345 |
| 32 | 1126 | 64.62 | 62.27 | 124 | 469 |
| 34 | 1195 | 68.58 | 66.60 | 133 | 602 |

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC


Parker Pond

B. 1 0.44 d = 0.4 x 42 d x 8.7 = 135 Ac-FT

Storage - Area Camps


based on field run topo

for HUD-FIP
plotted 1" = 50 FT

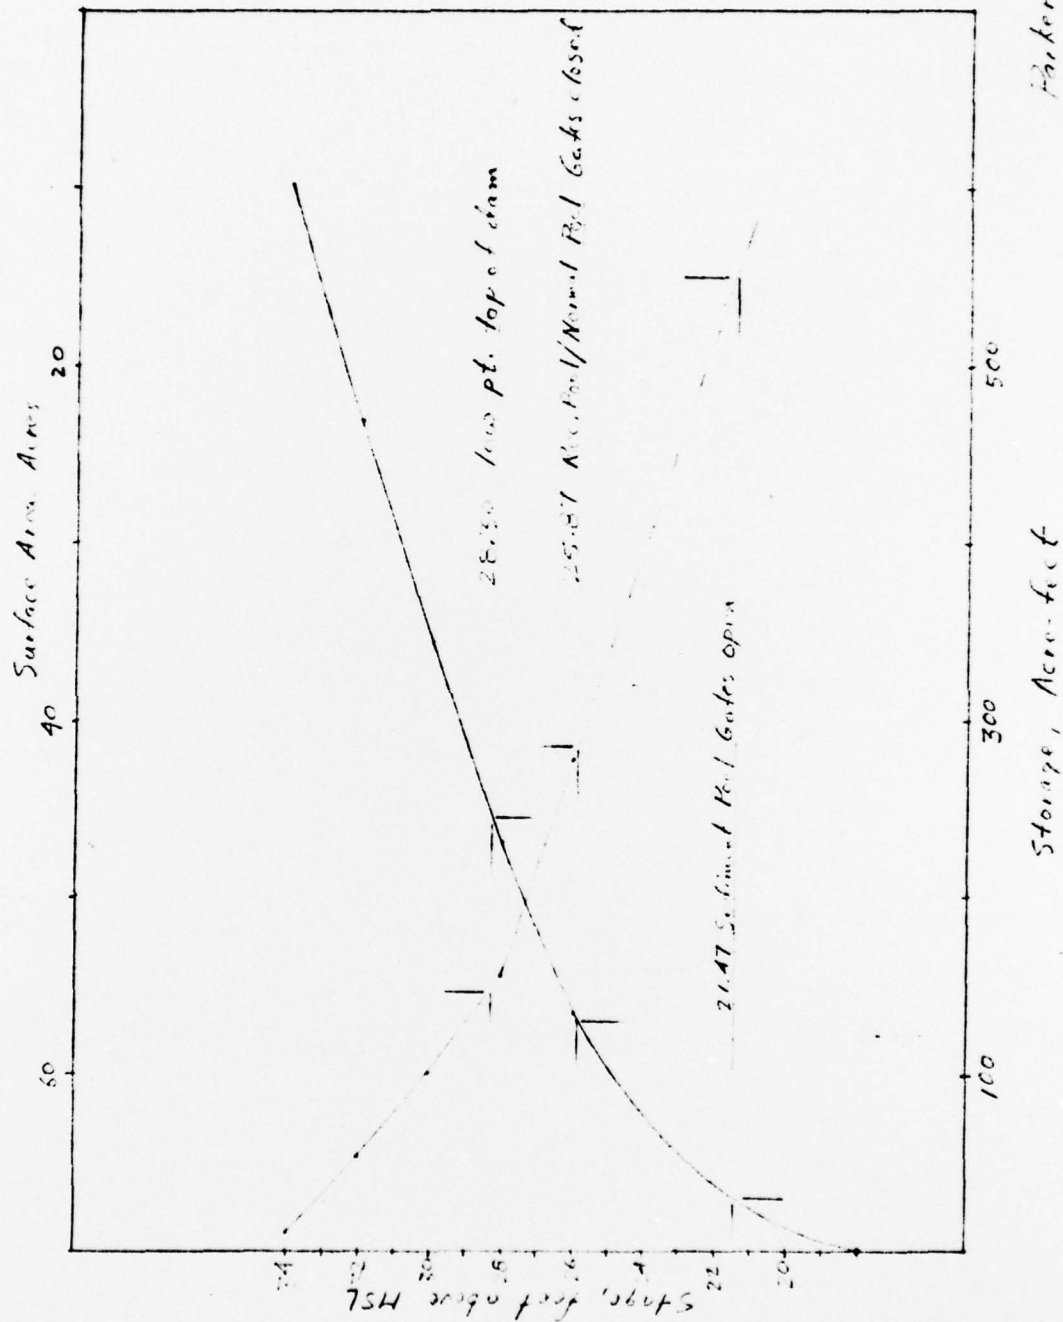

Parker Pond
Storage - Area
Curves

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

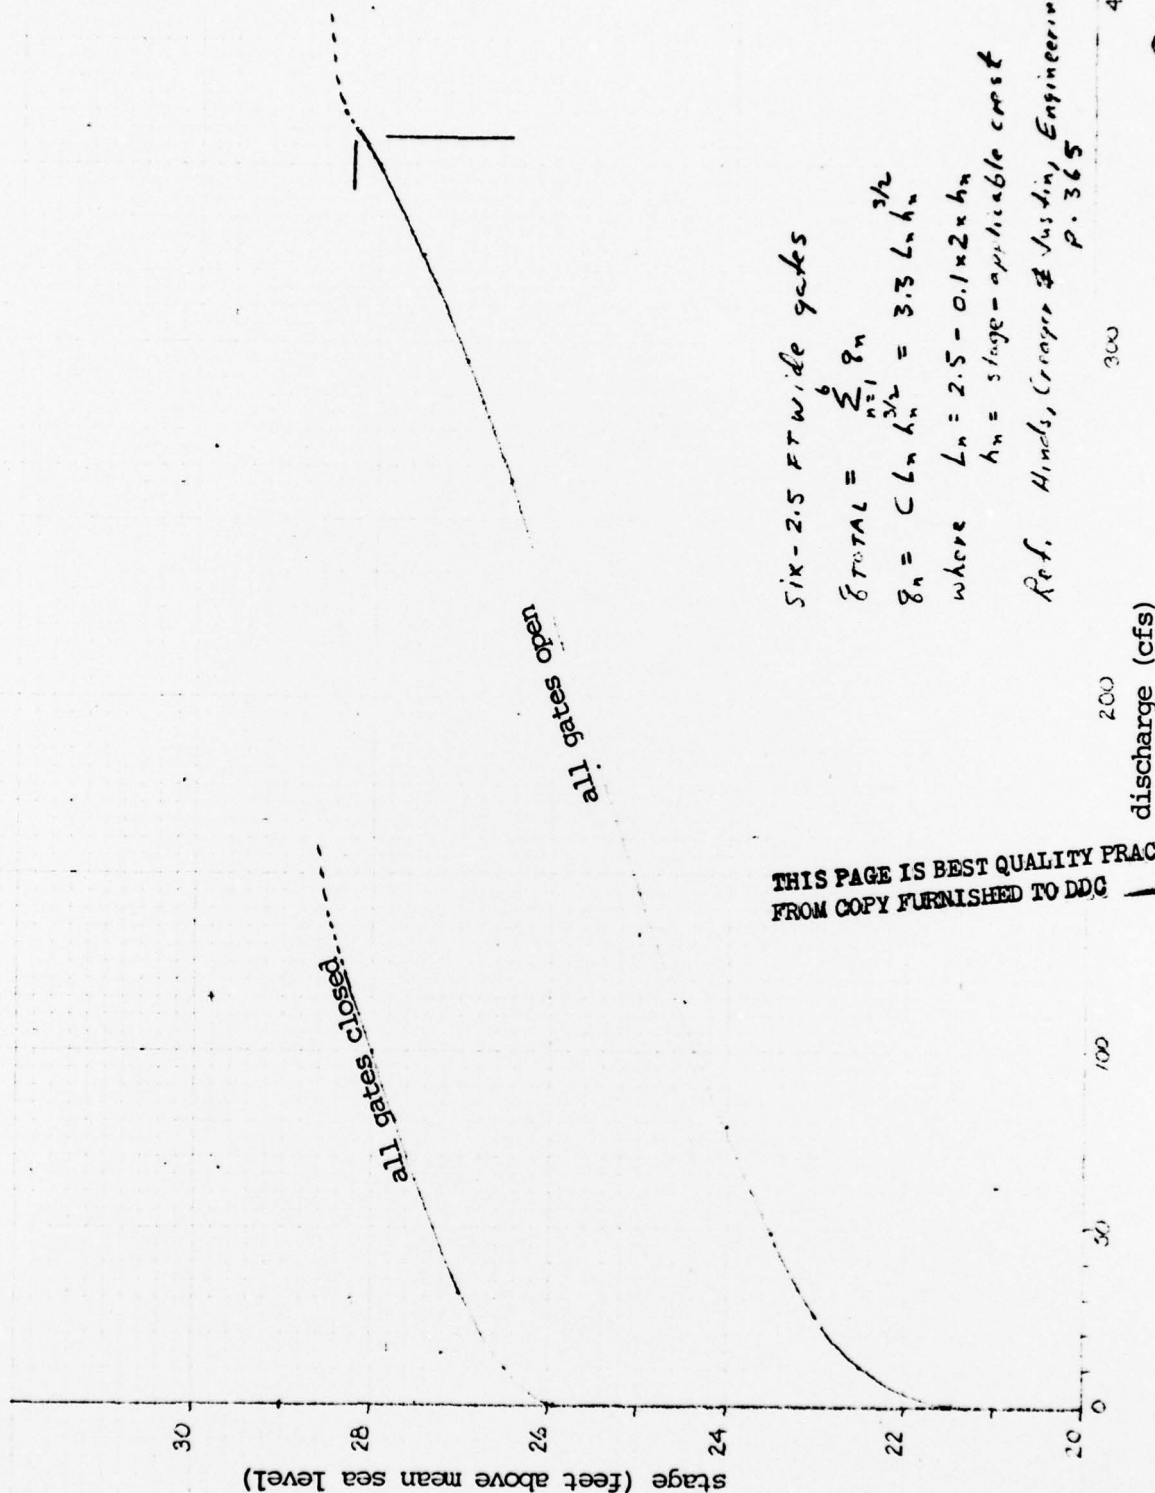

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

Six-2.5 ft wide gates

$$Q_{TOTAL} = \sum_{n=1}^6 Q_n$$

$$Q_n = C L_n h_n^{3/2} = 3.3 L_n h_n^{3/2}$$

where $L_n = 2.5 - 0.1 \times 2 \times h_n$
 h_n = stage - applicable crest

Ref. Hinds, Granger & Austin Engineering for Dams
p. 365

200 300 400

discharge (cfs)

PARKER POND
WOODS

Parker Pond

$$D.A. = 9.55 \text{ in}^2 @ 1:62500 \text{ scale} = 5947 \text{ Acres} = 9.29 \text{ mi}^2$$

SDF for Parker Pond : Small, low hazard \rightarrow Use 100 yr.

Using local gage records, sheets 6-10, with Log Pearson Type III Distribution to establish Q_{100} @ Parker Pond

| Stream | Gage No | Q_{100} | D.A. | CSM | $(9.29/D.A.)^{0.7}$ |
|---------------|---------|-----------|------|-----|---|
| Nassawango | 4855 | 1207 | 44.9 | 27 | $0.33 \times 1207 = 400 \text{ cfs} = 43 \text{ CSM}$ |
| Chicamacowico | 4900 | 738 | 15.0 | 50 | $0.71 \times 738 = 528 = 57$ |
| Beaverdam | 4865 | 1109 | 19.5 | 57 | $0.59 \times 1109 = 660 = 71$ |

looking at 25 & 50 yr. values for Gage 4865 :

| | | | | |
|------------|-----|------|----|------------------------------|
| Q_{50} : | 950 | 19.5 | 49 | $0.57 \times 950 = 560 = 60$ |
| Q_{25} : | 795 | 19.5 | 41 | $0.57 \times 795 = 469 = 50$ |

Comparing Gage records with regression eqn. from Maryland Geological Survey Report 16 : $A = 9.29 \text{ mi}^2$, $S = 6 \text{ FT/mi} = \frac{60-26}{5.68}$

$6 = 0.76$ geographic factor

$$P_{50} = 46 (9.29)^{.915} \times 6^{.377} \times (.76)^{.909} \pm 36.7\% = 541 \pm 198 \text{ range } 343-739 \text{ cfs}$$

$541 \approx 560$

i. Use gage records from #4865 to establish frequency line @ Parker Pond

$$\begin{aligned} \text{Use } Q_{25} &= 469 \text{ cfs} \\ Q_{50} &= 560 \text{ cfs} \\ Q_{100} &= 660 \text{ cfs} = \text{SDF} = 71 \text{ CSM} \end{aligned}$$

Statistics for Eayla Park Drive Dam (MD 00204)

| | | | |
|---|-------|-------------|----------------|
| D.A. = 19.5 mi ² | Stage | Disch., cfs | Storage, Ac-FT |
| S.A. = 48.6 Ac | 19.2 | 0 | 0 |
| Top of Dam elev. 26.0 | 20.5 | - | 80 |
| SDF = 1000 cfs = 200 CSM | 24.0 | 4000 | 443 |
| low stage spillway, L = 45 FT @ elev. 19.2 | 25.5 | 6000 | 675 |
| high stage spillway, L = 70 FT @ elev. 20.5 | 26.0 | - | - |


THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC

Parker Pond - Failure Hydrograph

ref. - Newton & Cripe for TVA, 1973 published in ASCE
Evaluation of Dam Safety, 1976, p. 437

Assume no tailwater

Dam Height = 28.3 - 18 say 10 FT, length = 350 FT



Assumed Breach geometry


$$Q_{max} = 0.23 \times Z \times \sqrt{g} \times Y_0^{5/2}$$

$$Q_{max} = 0.23 \times 17.5 \times 32.2^{1/2} \times 10^{5/2} = 7222 \text{ cfs}$$

Storage @ elev. 28.3 = 245 Acre-ft = V_b

$$Y = 0.64 Y_0 = 0.64 \times 10 = 6.4 \text{ FT}$$

$$S_c = 24 V_b / Q_{max} = 24 \times 245 / 7222 = 0.814 \text{ hrs.}$$

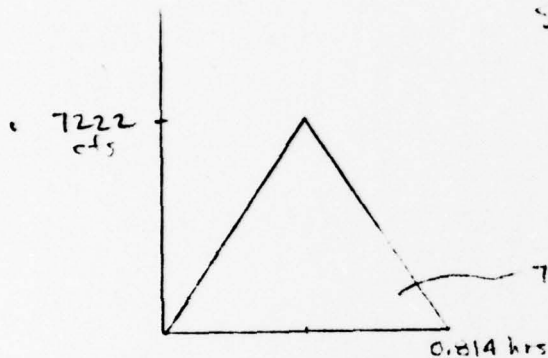

Assumed failure hydrograph

$$7222 \frac{\text{cfs}}{\text{sec}} \times 0.814 \text{ hr} \times 3600 \frac{\text{sec}}{\text{hr}} \times \frac{1 \text{ Acre-ft}}{43560 \text{ ft}^3} = 2.43 \approx 245 \text{ Acre-ft}$$

Use 4000 cfs as capacity Beaglin Park Drive Dam

$$P = 4000 / 7222 = 0.55 \rightarrow 1 - P = 0.45 = \text{Reg'd Stor.}$$

Inflow 1201

$$\text{Reg'd Storage} = 0.45 \times 245 = 110 \text{ Acre-ft.}$$

$$\text{Incremental Storage Avail. to elev. 27.5 (1/2 ft below overtopping elev.)} \\ = 675 - 443 = 232 \text{ Acre-ft}$$

∴ Beaglin Park will not overflow when it is at its O.H.W.
and superimpose on top its assumed
failure hydrograph from Parker Pond.

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC

FLOOD FLOW FREQUENCIES

LOG-PEARSON TYPE III METHOD

THE FOLLOWING FLOOD FREQUENCIES ARE COMPUTED USING THE PROCEDURE DESCRIBED IN "A UNIFORM TECHNIQUE FOR DETERMINING FLOOD FLOW FREQUENCIES", BULLETIN NO. 15 OF THE WATER RESOURCES COUNCIL, HYDROLOGY COMMITTEE, WASHINGTON, D.C., 1967. AN ATTEMPT WAS MADE TO IDENTIFY AND DELETE OR MODIFY OUTLIERS IN THE DATA. I.E., ALL MAXIMUM ANNUAL DISCHARGES ARE INCLUDED IN THE COMPUTATIONS.

THE PROCEDURE FOR DETERMINING THE SUFFICIENCY OF THE LENGTH OF RECORD IS DESCRIBED IN NCH-4, CHAPTER 16, PAGE 11.

THE PROGRAM AND DATA WILL BE READILY AVAILABLE TO ANYONE WISHING TO TRY MODIFICATIONS OR OTHER METHODS. A PLOTTING POSITION SUBROUTINE IS AVAILABLE ALSO.

THIS LISTING IS CURRENT TO WATER YEAR 1976 AND WILL BE UPDATED AS SOON AS THE 1977 WATER RESOURCES DATA IS RECEIVED.

W20
Water Resources Administration
Hydrologic Services Section

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC

HYDROLOGICAL LISTING OF ANNUAL MAXIMUM DISCHARGES

| | | | | | | | |
|------|------|------|------|------|-------|------|------|
| 258. | 485. | 588. | 410. | 920. | 348. | 542. | 761. |
| 597. | 361. | 611. | 665. | 515. | 597. | 121. | 200. |
| 452. | 434. | 480. | 431. | 347. | 1320. | 750. | 365. |
| 615. | 416. | | | | | | |

| | SKENNESS COEFFICIENT | MEAN | STANDARD DEVIATION |
|-------------|-------------------------|--------|-----------------------|
| ARITHMETIC | 1.14 | 545.03 | 258.32 |
| LOGARITHMIC | -0.6634 | 2.5822 | 0.2119 |

| Q1.01 | Q2 | Q5 | Q10 | Q25 | Q50 | Q100 | 1100 |
|-------|------|------|------|-------|-------|-------|-------|
| 115. | 517. | 750. | 683. | 1029. | 1124. | 1207. | 1282. |

LENGTH OF RECORD *** TEN PERCENT LEVEL OF SIGNIFICANCE

19 YEARS OF RECORD ARE NEEDED.

26 YEARS OF RECORD ARE AVAILABLE.

* * R E M A R K S * *

RECORDS GOOD.

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDC

HYDROLOGICAL LISTING OF ANNUAL MAXIMUM DISCHARGES

| | | | | | | | |
|------|------|------|------|------|------|------|------|
| 325. | 192. | 100. | 314. | 78. | 260. | 285. | 202. |
| 419. | 470. | 157. | 230. | 176. | 182. | 128. | 518. |
| 225. | 169. | 218. | 210. | 300. | 542. | 168. | 478. |
| 166. | | | | | | | |

SKEWNESS
COEFFICIENT

MEAN

STANDARD
DEVIATION

ARITHMETIC

0.92

299.20

131.88

LOGARITHMIC

0.0197

2.3617

0.2175

Q1.01

Q2

Q5

Q10

Q25

Q50

Q100

Q200

72.

230.

331.

437.

553.

644.

738.

837.

LENGTH OF RECORD *** TEN PERCENT LEVEL OF SIGNIFICANCE

23 YEARS OF RECORD ARE NEEDED.

25 YEARS OF RECORD ARE AVAILABLE.

* * R E M A R K S * *

RECORDS FAIR. OCCASIONAL REGULATION BY BIG HILL POND.

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG

4865(527) BEAVERDAM CREEK NR SALISBURY, MD. 1939-32 1939-75 4865

D.A. = 15.5 LAT 33-21-05 LONG 75-34-11

* DISCONTINUED PAGE *

CHRONOLOGICAL LISTING OF ANNUAL MAXIMUM DISCHARGES

| | | | | | | | |
|------|------|------|------|-------|------|------|------|
| 75. | 37. | 115. | 203. | 234. | 111. | 392. | 86. |
| 260. | 115. | 252. | 59. | 1480. | 217. | 95. | 143. |
| 207. | 653. | 502. | 338. | 209. | 305. | 337. | 733. |
| 214. | 337. | 487. | 239. | 631. | 317. | 135. | 296. |
| 175. | 303. | 365. | 212. | 409. | 417. | 254. | 339. |

| | SKENNESS COEFFICIENT | MEAN | STANDARD DEVIATION |
|-------------|-------------------------|--------|-----------------------|
| ARITHMETIC | 2.87 | 310.96 | 249.71 |
| LOGARITHMIC | -0.2692 | 2,3869 | 0.1127 |

| Q1.01 | Q2 | Q5 | Q10 | Q25 | Q50 | Q100 | Q200 |
|-------|------|------|------|------|------|-------|-------|
| 39. | 253. | 450. | 597. | 795. | 950. | 1107. | 1271. |

LENGTH OF RECORD *** TEN PERCENT LEVEL OF SIGNIFICANCE

32 YEARS OF RECORD ARE NEEDED.

40 YEARS OF RECORD ARE AVAILABLE.

* * R E M A R K S * *

RECORDS GOOD. RECORDS REPRESENT TOTAL FLOW AND INCLUDE FLOW OVER SPILLWAY, THROUGH SPILLWAY VALVE, OVER OR THROUGH FLOODGATE, AND LEAKAGE UNDER DAM. OCCASIONAL REGULATION AT LOW AND MEDIUM FLOW CAUSED BY HILL ABOVE STATION.

THIS PAGE IS BEST QUALITY PRACTICABLE
FROM COPY FURNISHED TO DDG


9.5 1A

100-yr Hydrograph - Approx. Routing

Norfolk & Sassafras sands - Group B Soils Use $RCN=70$ } Ref.
100 yr. rainfall = 7.9 in. \rightarrow Runoff, $Q = 4.37$ inches } USDA-SCS
EFM, Chap 2

$$\text{Volume} = \frac{4.37 \text{ in}}{12 \text{ in/ft}} \times 5947 \text{ Ac} = 2166 \text{ Ac-FT}$$

$$\text{Peak} = 660 \text{ cfs}, \text{ time base} = \frac{2 \times 2166 \text{ Ac-FT} \times 12.1 \frac{\text{cfs-hrs}}{\text{Ac-ft}}}{660 \text{ cfs}} = 79 \text{ hrs.}$$

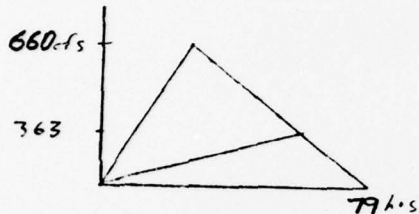

$$\text{Vol. check: } \frac{660 \frac{\text{ft}^3}{\text{sec}} \times 79 \text{ hrs} \times 3600 \frac{\text{sec}}{\text{hr}} \times \frac{1 \text{ Ac}}{43560 \text{ ft}^2}}{2} = 2154 \text{ Ac-FT} \approx 2166 \text{ CX}$$

$$\% \text{ of 100 yr. passing} = \frac{363 \text{ cfs}}{660 \text{ cfs}} = 55 \%$$

$$\therefore 1 - .55 = 0.45 = \frac{\text{Reg'd Storage}}{\text{Hydrograph Vol.}}$$

$$\begin{aligned} \text{Pool Vol., gates open} &= 30 \text{ Ac-FT} \\ \text{Max. Pool Vol.} &= 245 \text{ Ac-FT} \end{aligned} \left. \begin{array}{l} \\ \end{array} \right\} \begin{array}{l} 215 \text{ Ac-FT incremental flood} \\ \text{Vol. available} \end{array}$$

$$2166 \text{ Ac-FT} \times 0.45 = 975 \text{ Ac-FT} = \text{Reg'd Storage} \gg 215$$

\therefore Dam will bypass using estimated 100 yr flood event as SDF.

25-yr Hydrograph - Approx. Routing

25 yr rainfall = 6.3 in. \rightarrow Runoff = 3.04 inches

$$\text{Vol.} = \frac{3.04}{12} \times 5947 = 1506 \text{ Ac-FT}$$

$$25 \text{ yr. peak} = 469 \text{ cfs}, \text{ time base} = \frac{2 \times 1506 \text{ Ac-FT} \times 12.1}{469} = 77.7 \text{ hrs.}$$

$$\% \text{ of 25 yr passing} = \frac{363}{469} = 77.4\% \quad 1 - .774 = 0.226$$

$$1506 \times .226 = 340 > 215 \text{ Ac-FT incremental storage}$$

\therefore Dam will by-pass using est. 25 year flood event

Note: above calculations assume all gates open and lowered pool which is not conservative

APPENDIX E - GEOLOGY REPORT

Geology Report
Parker Pond Dam
Wicomico County, Maryland

Parker Pond Dam is located on the Eastern Shore approximately 2 miles southeast of Salisbury within the major geologic region of the Atlantic Coastal Plain. The dam site and impoundment area are underlain by recent alluvial deposits and unconsolidated sediments of the Quaternary System, Pleistocene Series, known as the Beaverdam sand. This formation is composed of white to buff, fine to medium quartz sand with a little silt and gravel. In situ, this material is relatively dense, not subject to long term settlement and should continue to provide competent support for the dam embankment.

The potential for leakage through the foundation materials exists considering that the Beaverdam sand is an extensive aquifer exhibiting moderate to high well yields. The quantity of leakage is dependent upon the permeability of the formation which varies according to density and fines content. Based upon the absence of seepage downstream, the formation in the vicinity of the dam may be of relatively low permeability and/or the pond floor has been rendered impervious by siltation.

REFERENCES

1. Rasmussen, W. C., Slaughter, T. H., and Hulme, A. E., 1955. The Water Resources of Somerset, Wicomico, and Worcester Counties, Bulletin 16, State of Maryland, Board of Natural Resources, Department of Geology, Mines, and Water Resources Baltimore; Maryland.
2. Boggess, D. H., and Heidel, S. G., 1968, Water Resources of the Salisbury Area, Maryland, Report of Investigations No. 3, Maryland Geological Survey.
3. Hansen, H. J. III, 1966. Pleistocene Stratigraphy of the Salisbury Area, Maryland and Its Relationship to the Lower Eastern Shore: A Subsurface Approach, Report of Investigations No. 2, Maryland Geological Survey.